


## WZ1040

Прямозубые шестерни

Материал: ~1.0503 (C45)~690 Н/мм<sup>2</sup>

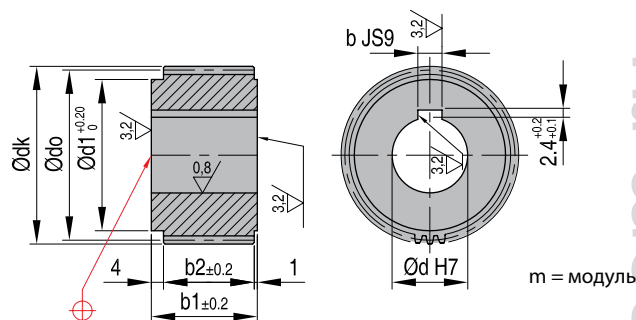


| Номер             | d      | m    | z  | d0     | dk     | b JS9 | b1 | b2 | d1 |
|-------------------|--------|------|----|--------|--------|-------|----|----|----|
| WZ1040 25-1,25-45 | 56,25  | 1,25 | 45 | 56,25  | 58,75  | 8     | 35 | 30 | 50 |
| WZ1040 25-1,25-50 | 62,50  | 1,25 | 50 | 62,50  | 65,00  | 8     | 35 | 30 | 50 |
| WZ1040 25-1,25-60 | 75,00  | 1,25 | 60 | 75,00  | 77,50  | 8     | 35 | 30 | 50 |
| WZ1040 30-1,25-45 | 56,25  | 1,25 | 45 | 56,25  | 58,75  | 8     | 45 | 40 | 50 |
| WZ1040 30-1,25-50 | 62,50  | 1,25 | 50 | 62,50  | 65,00  | 8     | 45 | 40 | 50 |
| WZ1040 30-1,25-60 | 75,00  | 1,25 | 60 | 75,00  | 77,50  | 8     | 45 | 40 | 50 |
| WZ1040 30-1,25-70 | 87,50  | 1,25 | 70 | 87,50  | 90,00  | 8     | 45 | 40 | 50 |
| WZ1040 30-1,5-45  | 67,50  | 1,5  | 45 | 67,50  | 70,50  | 10    | 45 | 40 | 60 |
| WZ1040 30-1,5-50  | 75,00  | 1,5  | 50 | 75,00  | 78,00  | 10    | 45 | 40 | 60 |
| WZ1040 30-1,5-60  | 90,00  | 1,5  | 60 | 90,00  | 93,00  | 10    | 45 | 40 | 60 |
| WZ1040 30-1,5-70  | 105,00 | 1,5  | 70 | 105,00 | 108,00 | 10    | 45 | 40 | 60 |
| WZ1040 35-1,5-45  | 67,50  | 1,5  | 45 | 67,50  | 70,50  | 10    | 50 | 45 | 60 |
| WZ1040 35-1,5-50  | 75,00  | 1,5  | 50 | 75,00  | 78,00  | 10    | 50 | 45 | 60 |
| WZ1040 35-1,5-55  | 82,50  | 1,5  | 55 | 82,50  | 85,50  | 10    | 50 | 45 | 60 |
| WZ1040 35-1,5-60  | 90,00  | 1,5  | 60 | 90,00  | 93,00  | 10    | 50 | 45 | 60 |
| WZ1040 35-1,5-70  | 105,00 | 1,5  | 70 | 105,00 | 108,00 | 10    | 50 | 45 | 60 |

| Номер            | d      | m   | z  | d0     | dk     | b JS9 | b1 | b2 | d1 |
|------------------|--------|-----|----|--------|--------|-------|----|----|----|
| WZ1040 35-2-40   | 80,00  | 2   | 40 | 80,00  | 84,00  | 10    | 50 | 45 | 70 |
| WZ1040 35-2-45   | 90,00  | 2   | 45 | 90,00  | 94,00  | 10    | 50 | 45 | 70 |
| WZ1040 35-2-50   | 100,00 | 2   | 50 | 100,00 | 104,00 | 10    | 50 | 45 | 70 |
| WZ1040 35-2-55   | 110,00 | 2   | 55 | 110,00 | 114,00 | 10    | 50 | 45 | 70 |
| WZ1040 35-2-60   | 120,00 | 2   | 60 | 120,00 | 124,00 | 10    | 50 | 45 | 70 |
| WZ1040 35-2-70   | 140,00 | 2   | 70 | 140,00 | 144,00 | 10    | 50 | 45 | 70 |
| WZ1040 47-2-40   | 80,00  | 2   | 40 | 80,00  | 84,00  | 10    | 65 | 60 | 70 |
| WZ1040 47-2-45   | 90,00  | 2   | 45 | 90,00  | 94,00  | 10    | 65 | 60 | 70 |
| WZ1040 47-2-50   | 100,00 | 2   | 50 | 100,00 | 104,00 | 10    | 65 | 60 | 70 |
| WZ1040 47-2-60   | 120,00 | 2   | 60 | 120,00 | 124,00 | 10    | 65 | 60 | 70 |
| WZ1040 47-2-70   | 140,00 | 2   | 70 | 140,00 | 144,00 | 10    | 65 | 60 | 70 |
| WZ1040 47-2,5-40 | 100,00 | 2,5 | 40 | 100,00 | 105,00 | 10    | 65 | 60 | 70 |
| WZ1040 47-2,5-45 | 112,50 | 2,5 | 45 | 112,50 | 117,50 | 10    | 65 | 60 | 70 |
| WZ1040 47-2,5-50 | 125,00 | 2,5 | 50 | 125,00 | 130,00 | 10    | 65 | 60 | 70 |
| WZ1040 47-2,5-60 | 150,00 | 2,5 | 60 | 150,00 | 155,00 | 10    | 65 | 60 | 70 |
| WZ1040 47-2,5-70 | 175,00 | 2,5 | 70 | 175,00 | 180,00 | 10    | 65 | 60 | 70 |

## WZ1050

Шестерни промежуточной передачи

Материал: ~1.0503 (C45)~690 Н/мм<sup>2</sup>

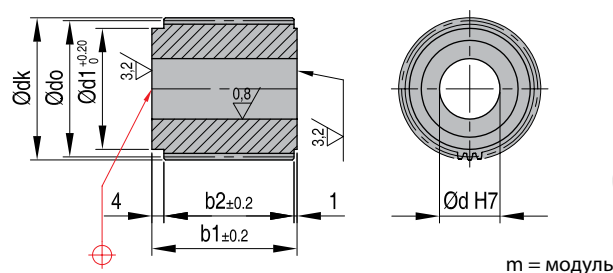

| Номер             | d     | m    | z  | d0    | dk    | b1 | b2 | d1 |
|-------------------|-------|------|----|-------|-------|----|----|----|
| WZ1050 10-1,25-16 | 20,00 | 1,25 | 16 | 20,00 | 22,50 | 34 | 29 | 16 |
| WZ1050 10-1,25-17 | 21,25 | 1,25 | 17 | 21,25 | 23,75 | 34 | 29 | 16 |
| WZ1050 10-1,25-18 | 22,50 | 1,25 | 18 | 22,50 | 25,00 | 34 | 29 | 16 |
| WZ1050 10-1,25-20 | 25,00 | 1,25 | 20 | 25,00 | 27,50 | 34 | 29 | 16 |
| WZ1050 10-1,25-25 | 31,25 | 1,25 | 25 | 31,25 | 33,75 | 34 | 29 | 16 |
| WZ1050 10-1,5-16  | 24,00 | 1,5  | 16 | 24,00 | 27,00 | 36 | 31 | 19 |
| WZ1050 10-1,5-18  | 27,00 | 1,5  | 18 | 27,00 | 30,00 | 36 | 31 | 19 |
| WZ1050 10-1,5-20  | 30,00 | 1,5  | 20 | 30,00 | 33,00 | 36 | 31 | 19 |
| WZ1050 10-1,5-25  | 37,50 | 1,5  | 25 | 37,50 | 40,50 | 36 | 31 | 19 |
| WZ1050 10-2-16    | 32,00 | 2    | 16 | 32,00 | 36,00 | 38 | 33 | 26 |

| Номер            | d     | m   | z  | d0    | dk    | b1 | b2 | d1 |
|------------------|-------|-----|----|-------|-------|----|----|----|
| WZ1050 10-2-18   | 36,00 | 2   | 18 | 36,00 | 40,00 | 38 | 33 | 26 |
| WZ1050 10-2-20   | 40,00 | 2   | 20 | 40,00 | 44,00 | 38 | 33 | 26 |
| WZ1050 10-2-25   | 50,00 | 2   | 25 | 50,00 | 54,00 | 38 | 33 | 26 |
| WZ1050 10-2-30   | 60,00 | 2   | 30 | 60,00 | 64,00 | 38 | 33 | 26 |
| WZ1050 12-2,5-16 | 40,00 | 2,5 | 16 | 40,00 | 45,00 | 40 | 35 | 34 |
| WZ1050 12-2,5-18 | 45,00 | 2,5 | 18 | 45,00 | 50,00 | 40 | 35 | 34 |
| WZ1050 12-2,5-20 | 50,00 | 2,5 | 20 | 50,00 | 55,00 | 40 | 35 | 34 |
| WZ1050 12-2,5-25 | 62,50 | 2,5 | 25 | 62,50 | 67,50 | 40 | 35 | 34 |
| WZ1050 12-2,5-30 | 75,00 | 2,5 | 30 | 75,00 | 80,00 | 40 | 35 | 34 |